

ROM ID INFORMATION TABLE:

Verify the ECM ROM ID before updating the vehicle's software. Refer to the table below.

Model	Model Year	ECM P/N	T/M	ROM ID	
				Previous	New
Accent RB 1.6 GDI	2012MY	39110-2BAD5 39110-2BAD7	AT	GGRB-ANU6PS00C00 GGRB-ANU6PS01C00 GGRB-ANU6PS02C00 GGRB-ANU6PS03C00 GGRB-ANU6PS04C00 GGRB-ANU6PS00C0A GGRB-ANU6PS01CA0 GGRB-ANU6PS02CA0 GGRB-DNU6PS02C00	GGRB-DNU6PS04C00
	2013MY	39110-2BAS1		GGRB-DNU6PS00C00 GGRB-DNU6PS01C00 GGRB-DNU6PS02C00 GGRB-DNU6PS03C00	

Model	Model Year	ECM P/N	T/M	IMMO	ROM ID	
					Previous	New
Veloster FS 1.6 GDI	2012MY	39110-2BBH0	DCT	Yes (Push Button Start)	GGFS-BFU6FS00H00 GGFS-BFU6FS01H00 GGFS-BFU6FS02H00 GGFS-BFU6FS03H00 GGFS-BFU6FS04H00 GGFS-BFU6FS05H00 GGFS-BFU6FS06H00 GGFS-BFU6FF00H00	GGFS-DFU6FS03H00
	2013MY	39110-2BBB7			GGFS-DFU6FS00H00 GGFS-DFU6FS01H00 GGFS-DFU6FS02H00	
	2012MY	39110-2BBH3		No (Key Start)	GGFS-BFU6ES00H00 GGFS-BFU6ES01H00 GGFS-BFU6ES02H00 GGFS-BFU6ES03H00 GGFS-BFU6ES04H00 GGFS-BFU6ES05H00 GGFS-BFU6ES06H00 GGFS-BFU6EF00H00	GGFS-DFU6ES03H00
	2013MY	39110-2BBC7 (13MY)			GGFS-DFU6ES00H00 GGFS-DFU6ES01H00 GGFS-DFU6ES02H00	

GENERAL PRECAUTIONS:

- Connect the USB cable between the GDS and the VCI.
- Connect the 16-pin DLC connector from the VCI into the DLC located under the driver's side dash.



* NOTE

Make sure the battery icon at the bottom right of the GDS laptop shows at least 50%; if not, charge the GDS or attach a battery charger.

- Turn off all lights (Do not leave the headlight switch in auto mode) and all accessories (including heater/air conditioner/fan, audio, heated seats, rear defroster, etc) to ensure the battery will not be discharged during the update.
- Perform the update with the ignition key in the ON position.
- Do not disconnect any cables connected to the vehicle or the GDS during the update.
- Do not start the engine or turn the ignition switch OFF during the update.

* NOTE


Confirm your GDS has the most recent version. If not, connect the GDS to an Internet port, open the GDS home page and select "Update". Refer to instructions on hmaservice.com if necessary.

If you encounter GDS related problems, call the GIT Helpline at 888-437-0308.


SERVICE PROCEDURE:

GDS AUTO MODE ECM UPDATE PROCEDURE

1. From the GDS home page, select **ECU Upgrade**. If necessary, select the VIN.
2. Select **Engine** as the system and then select **OK**.
3. Select **Auto Mode** and then select **Next**.
4. From the **System** tab, select **Engine** and then select **OK**. The GDS will read the ROM ID. Confirm the ROM is applicable as shown on Page 1, “ROM ID Information”.

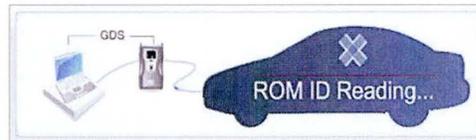

5. Select update event as listed on the **GDS Event list of page-1**. Select **Upgrade**.

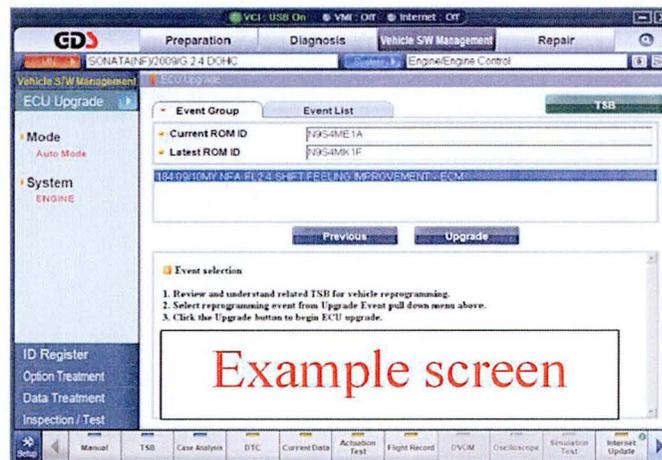

6. If the screen indicates “**Voltage is OK**” (voltage > 12volts), select **OK**. If not, select **CANCEL** and charge the vehicle battery by running the engine for 10 minutes.
7. Updating will occur until 100% is reached on the bar graph.
8. When prompted turn **OFF ignition 30 seconds** then turn **ON** before going to engine start.
NOTE: Failure to perform this 30 second reset may result in the DCT being inoperative.
9. The GDS will confirm that ECM reprogramming is successfully finished. Select **OK**.
10. If the ECM update was not successful, go to **GDS MANUAL MODE ECM UPDATE PROCEDURE**.
11. Check for DTC in all systems and Erase All DTC that stored due to loss of CAN communication during the ECM Update.
12. Start the engine to confirm proper operation.
13. Clear DTC in the BlueLink system per instructions of TSB 12-BE-005-2.

*** NOTE:**

In event of AUTO MODE ECU Update failure:

- You must attempt MANUAL MODE. Use the ECM P/N from the vehicle's ECM label if it is not clear from the ROM ID Table as to the correct ECM P/N to use for your vehicle.
- Replacing an ECM without carefully documenting that a MANUAL MODE update attempt was made will result in claims charge back.

GDS MANUAL MODE ECM UPDATE PROCEDURE

*** NOTE**

- GDS Manual Mode is intended for recovery of an ECM Update should it begin but then later fail in process in the Auto Mode.
- The ECM connectors must be disconnected for 15 minutes to reset its contents then perform this Manual Mode Update.
- Do not force Manual Mode if you get an error in Auto Mode that the vehicle's current ROM ID did not apply.
- It is critical to identify the correct ECM Part Number in the PASSWORD table or the ECM may be permanently damaged. It is recommended to remove ECM and read the part number from the label to confirm.

1. From the GDS home page, select **ECU Upgrade**. If necessary, select the VIN.
2. Select **Engine** as the system and then select **OK**.
3. Select **Manual Mode** and then select Next.
4. From the **System** tab, select **Engine** and then select **OK**.
5. Select update event as per the **GDS Event List of page-1**, then select **Upgrade**.
6. Be certain to enter the exact appropriate password from the table below and select **OK**. **See the important NOTE above.**
7. The remaining steps are same as Steps 6~13 of the Auto Procedure.

Accent (RB):

MENU	PASSWORD
RB 1.6 AT NON IMMO : 39110-2BAD5/D7/S1	1021

Veloster (FS):

MENU	Start Type	PASSWORD
FS 1.6 DCT IMMO : 39110-2BBH0/B7	Push Button Start	1027
FS 1.6 DCT NON IMMO : 39110-2BBH3/C7	Key Start	1028